

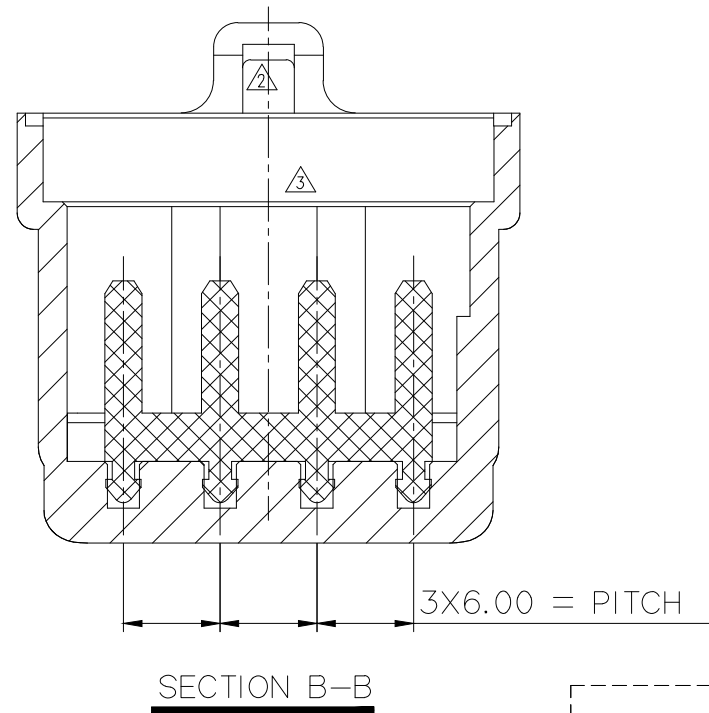
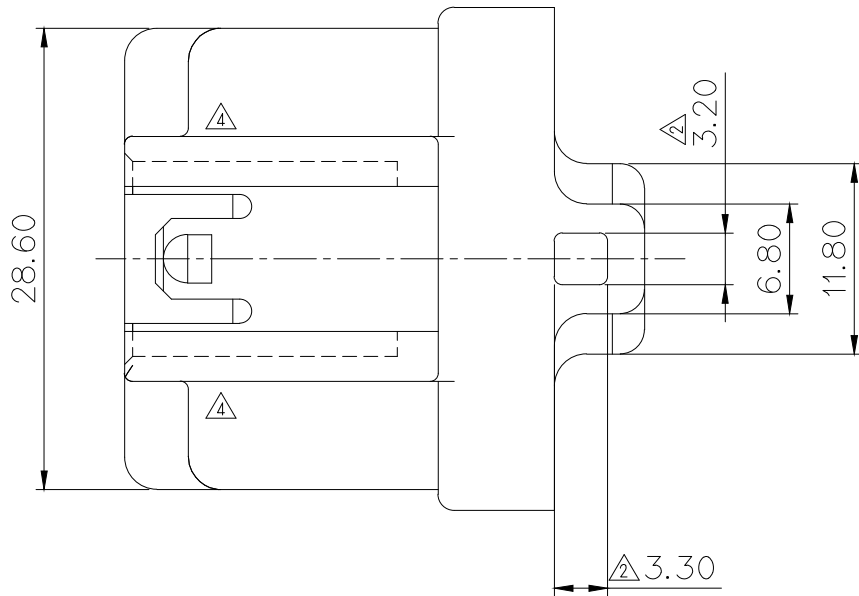
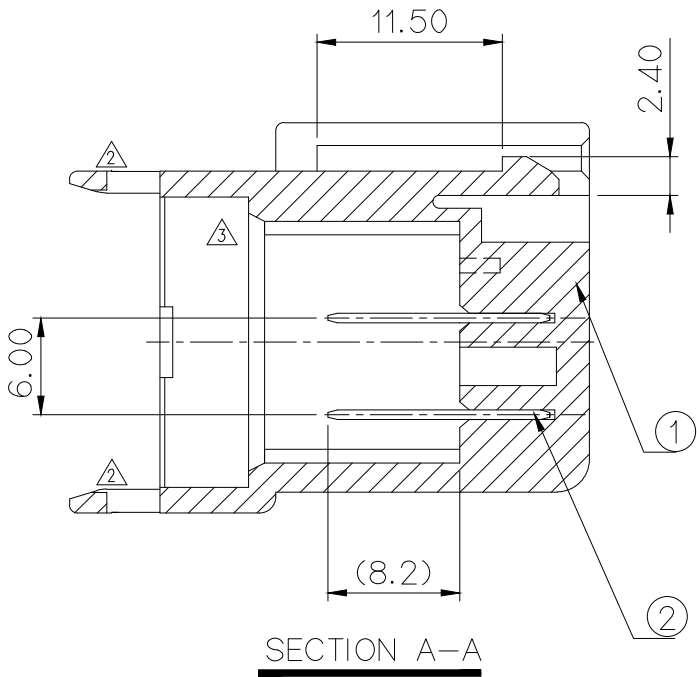
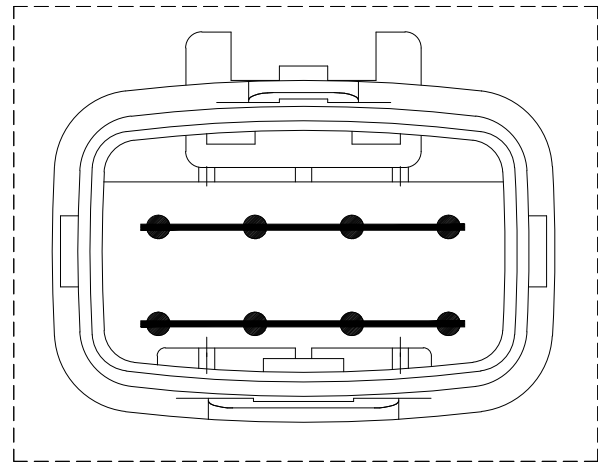
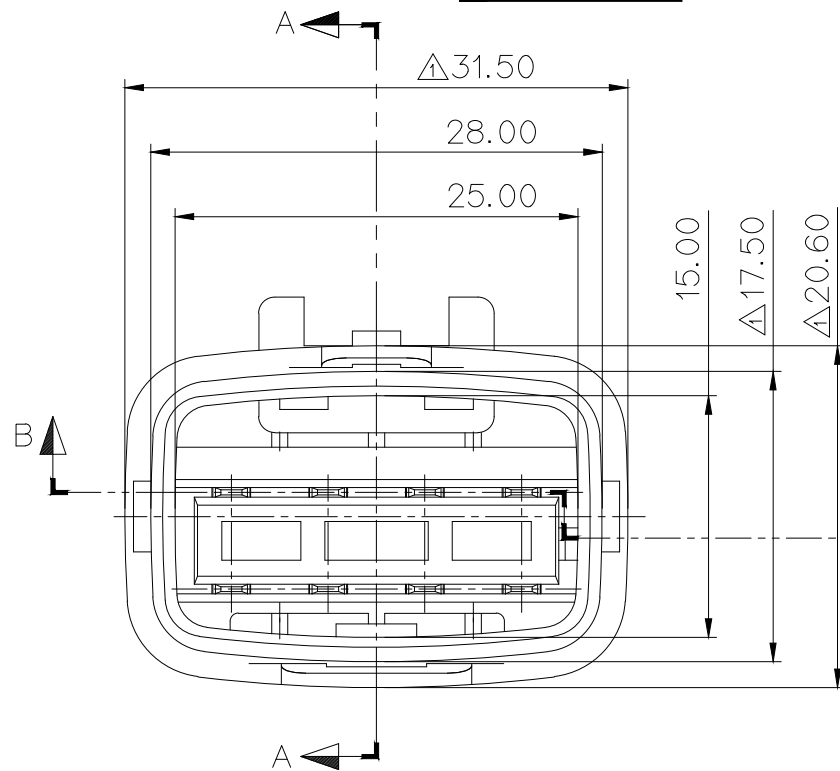


②	△ST791956-3 (P901956)	ASC WP JOINT TAB TM'L(4P)	BRASS	PRE-TIN
①	MG672590	ASC WP JOINT 8M HS'G	SEE TABLE	△△SEE TABLE
NO.	PART NO.	PART NAME	MATERIAL	FINISH

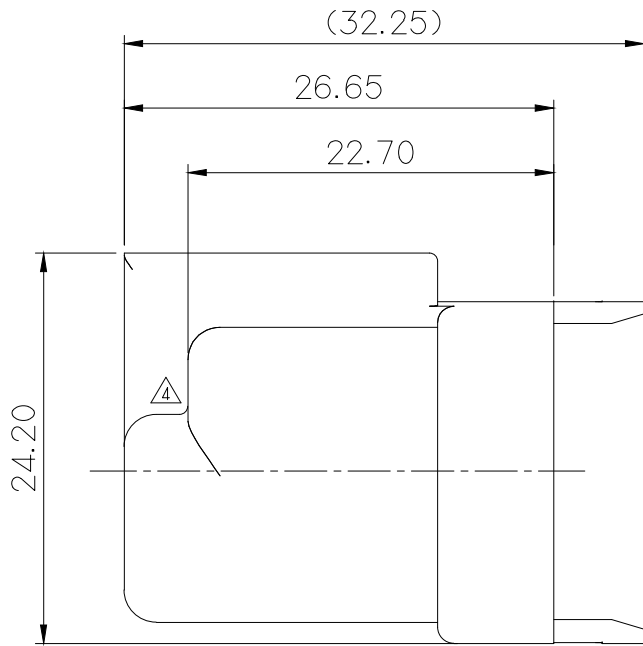

△△	NO.	MATERIAL	COLOR
	0	P B T	NATURAL
	1		RED
	2		BLUE
	20		JADE
	3		YELLOW
	4		GRAY
*	40		DARK GRAY
*	41		LIGHT GRAY
	5		BLACK
	6		DARK GREEN
	7		BROWN
	8		LIGHT GREEN
	9		MAGENTA
	11		ORANGE

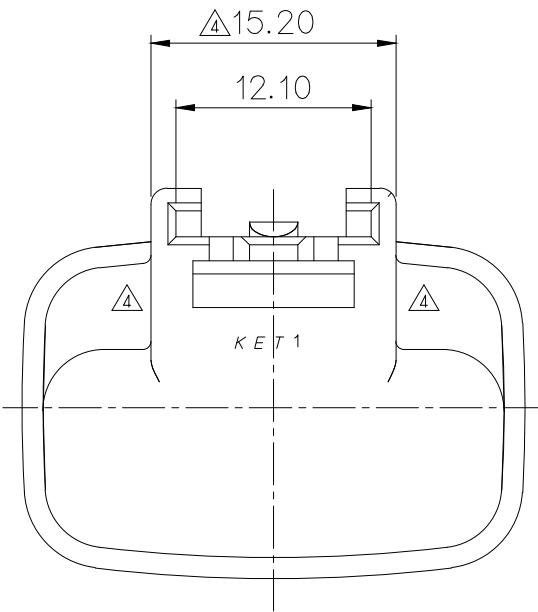

주 기

- 1.기능상 유해한 BURR 및 WELDLINE등이 없을것.
- 2.상대 CONNECTOR: MG652584
- △ 3.제품내 함유된 6대 유해물질(납, 수은, 카드뮴, 6가크롬, PBBs, PBDEs)은 EU ELV 지침 및 RoHS 법규에서 지정한 최대 허용 농도를 초과해서는 안된다.

NOTE

1. MUST BE FREE OF BURR, WELDLINE AND IMPERFECTION THAT AFFECT FUNCTION.
2. APPLICABLE CONNECTOR : MG652584
- △ 3. 6 HAZARDOUS SUBSTANCES IN PARTS (LEAD, MERCURY, CADMIUM, HEXAVALENT CHROMIUM, PBBs, PBDEs) SHALL NOT EXCEED THE MAXIMUM PERMISSIBLE CONCENTRATION PRESCRIBED UNDER EU ELV DIRECTIVE & RoHS REGULATION.

△	ECO-2109-074 근거 도면 재작성 (구성부품표 최신화)	CTI	KSC	HYJ	'21.09.13
△	ECO-1809-210 근거 도면 재작성 (색상표 오기입 수정)	JH	KSC	CJH	'18.09.17
△	ECO-1501-446 근거 도면 재작성 (연진미려화관련 색상추가)	KCS	HYJ	LSY	'15.01.29
△	ECO-1501-337 근거 도면 재작성 (CLIP 가이드 강도보강)	KCS	HYJ	LSY	'15.01.26
△	ECO-1212-096에 근거 도면 재작성	YMK	CSH	HSJ	12.12.12
△	설계사양변경(S060211)근거 도면 재작성 (LOCK부 형상변경)	LDG	HSJ	KKJ	'06.07.21
△	시방변경(S040083)의거 도면 재작성	KDJ	4/6	1/6	'04.07.03
LTR	REVISION RECORD	DR.	CHK.	APP.	DATE
DR.	KDJ. '04.06.17	CHK.			
CHK.	4/6	APP.	1/6		

MATERIAL	SEE TABLE	KET KOREA ELECTRIC ENGINEERED TERMINAL CO., LTD.
FINISH	SEE TABLE	
WIRE RANGE		
INSULATION		CLASS .090 II
		TYPE
TOLPRANCE EXCEPT AS NOTED	SCALE 2/1	PART NO. MG643362
PART NAME	ASC WP JOINT 8M ASS'Y (4+4)	



ISSUE MARK