


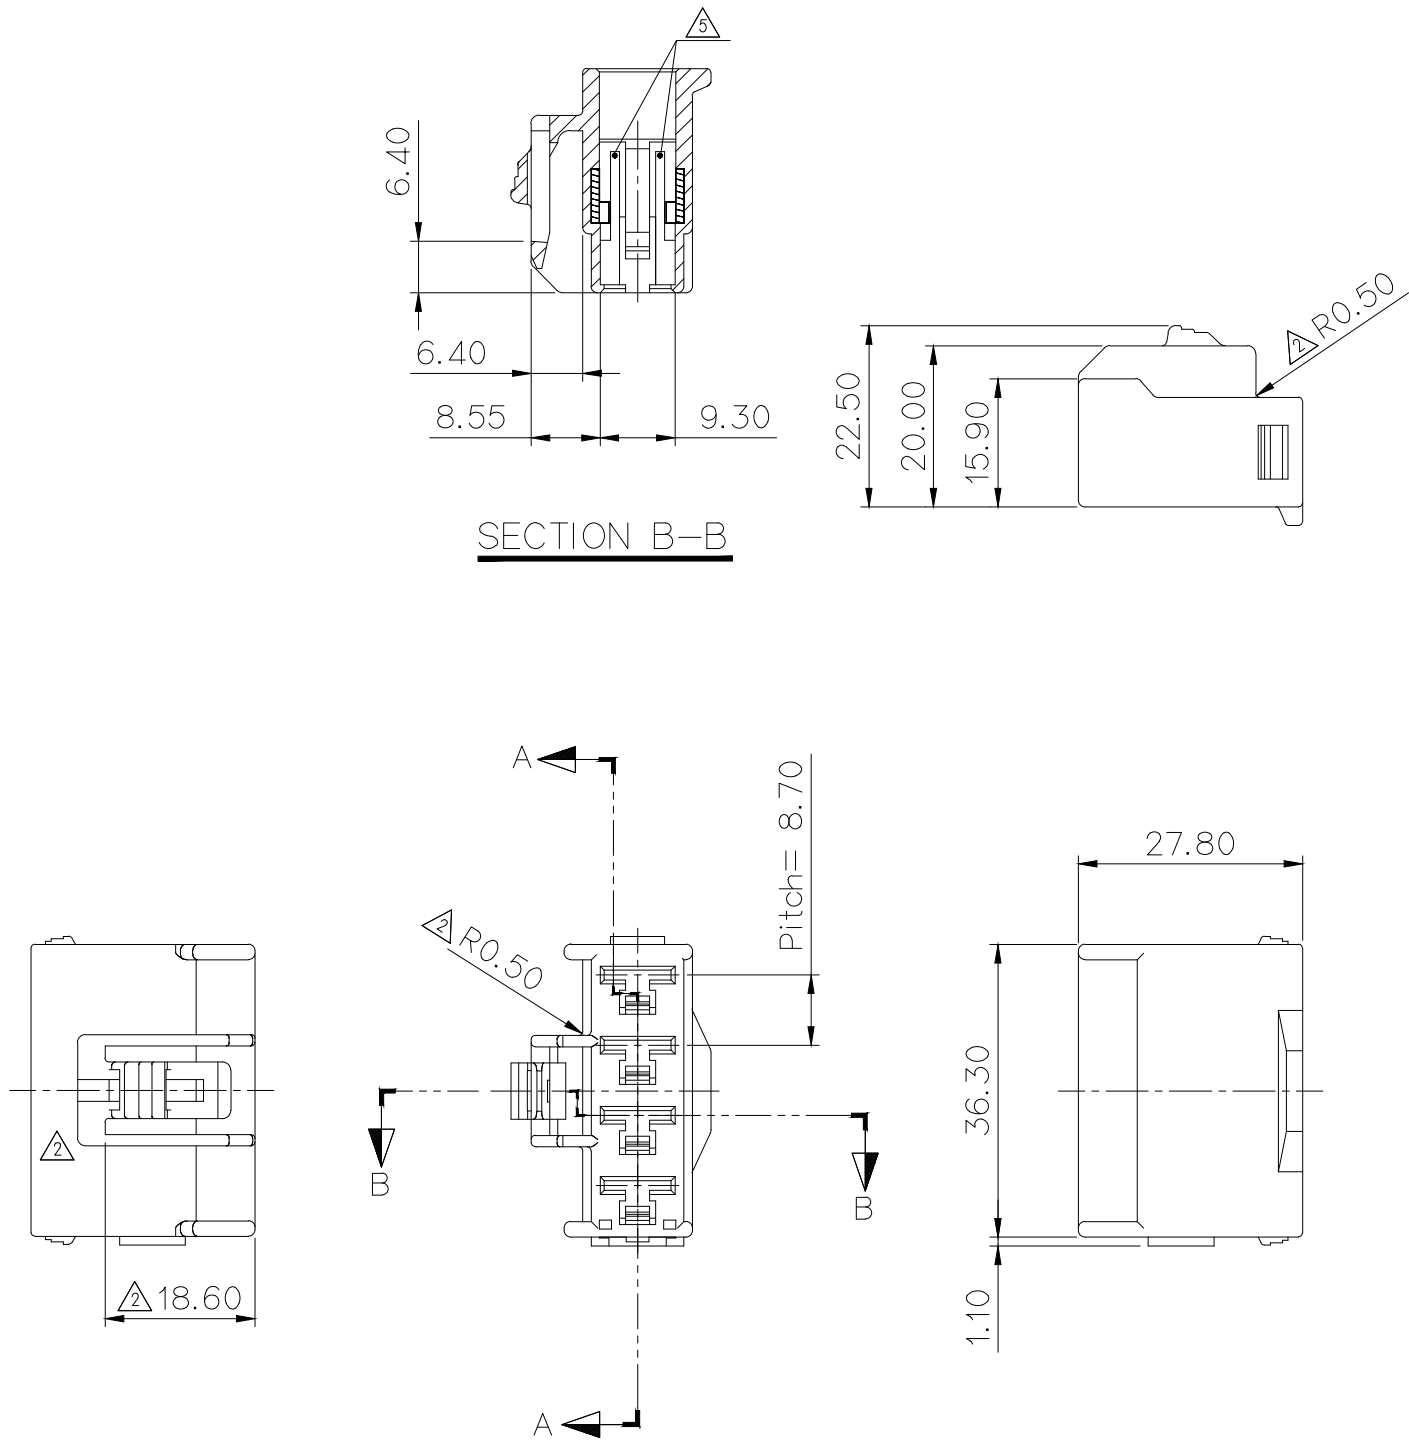

NOTE


1. MUST BE FREE OF FLASH, WELDLINE AND IMPERFECTION THAT AFFECT FUNCTION.
2. APPLICABLE HOUSING : MG641928
APPLICABLE TERMINAL: ST730642, 643
3. SPACER MUST BE KEEP AND SUPPLY FOR FIRST LOCKING CONDITION AS THIS DRAWING.
4. 6 HAZARDOUS SUBSTANCES IN PARTS (LEAD, MERCURY, CADMIUM, HEXAVALENT CHROMIUM, PBBs, PBDEs) SHALL NOT EXCEED THE MAXIMUM PERMISSIBLE CONCENTRATION PRESCRIBED UNDER EU ELV DIRECTIVE & RoHS REGULATION.

6	ECO-1901-445 근거 도면 제작성	STJ	HYJ	CJH	19.01.24
5	ECO-1808-419 근거 도면 제작성	SY.L	HYJ	CJH	18.08.30

GENERAL TOLERANCE (HOUSING)							USED ON
10 MAX	50 MAX	100 MAX	250 MAX	250 VR	ANGLE	ECCENT	
±0.2	±0.3	±0.55	±0.95	±1.4	±30'	0.1	

NO.	PART NO.	PART NAME	COLOR	MATERIAL
1	MG671924	312 II 4P PLUG HS'G	SEE TABLE	SEE TABLE
2	MG671925	312 II 4P SPACER	YELLOW	PBT

NO.	MATERIAL	COLOR
* 0	PBT	NATURAL
1		RED
* 2		BLUE
20		JADE
3		YELLOW
4		GRAY
40		DARK GRAY
41		LIGHT GRAY
* 5		BLACK
6		DARK GREEN
7		BROWN
8		LIGHT GREEN
9		MAGENTA
11		ORANGE

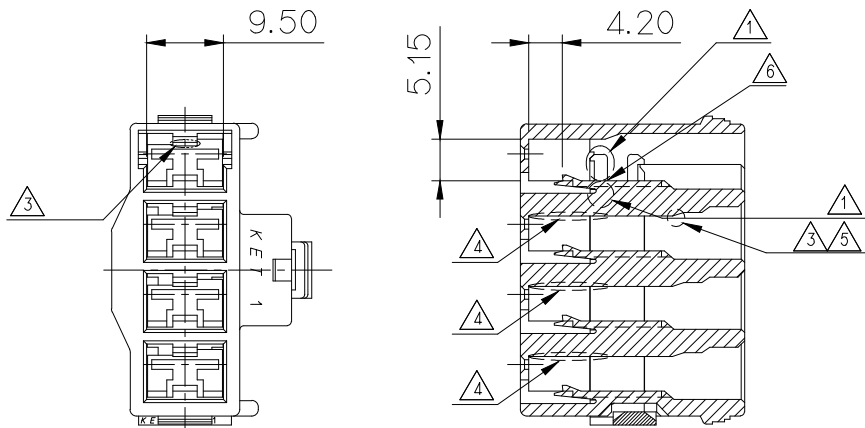

주 기

SECTION A-A

1. 기능상 유해한 BURR 및 WELDLINE 등이 없을 것.
2. 적용 HOUSING: MG641928
적용 TERMINAL: ST730642, 643
3. SPACER는 본 도면사양으로 1차 조립 할 것.
4. 제품내 함유된 6대 유해물질 (납,수은,카드뮴,6가크롬, PBBs,PBDEs)은 EU ELV 지침 및 RoHS 법규에서 지정한 최대 허용 농도를 초과해서는 안된다.

△	HSG 란스 홀 내측 실 보강 (ECO-1409-197) 근거	ASY	HYJ	LSY	'14.09.29	MATERIAL	SEE TABLE	 KOREA ELECTRIC TERMINAL CO., LTD.	
3	ECO-1402-160 근거 도면 재작성	KJY	CSH	CWK	'14.02.21	FINISH	SEE TABLE		
2	설계사양변경(ECO-1112-378)근거 도면재작성 (LEVER 및 GUIDE 파손 개선)	HYJ	CSH	HSH	'11.12.21	WIRE RANGE	CLASS		312
1	설계사양변경(S080294)근거 도면 재작성 (SPACER 2차 LOCK부 형상 변경 외)	KMH			'08.12.02	INSULATION	TYPE		7283-3040
△	검사성적서 합격에 따른 도면 재작성	WON			'00.03.10		PART NO.		MG651926
LTR	REVISION RECORD	DR.	CHK.	APP.	DATE	TOLERANCE EXCEPT AS NOTED	SCALE 1/1		
DR.	WON. 1999.7.22	CHK.			3.09	PART NAME	312 II 4P PLUG HOUSING ASSEMBLY		
CHK.		APP.	S.I. SAEP		3.10				

APPROVED

2019-11-06

KOREA ELECTRIC
TERMINAL CO., LTD.
Korea Electric Te
rminal Co., LTD.

ISSUE MARK