

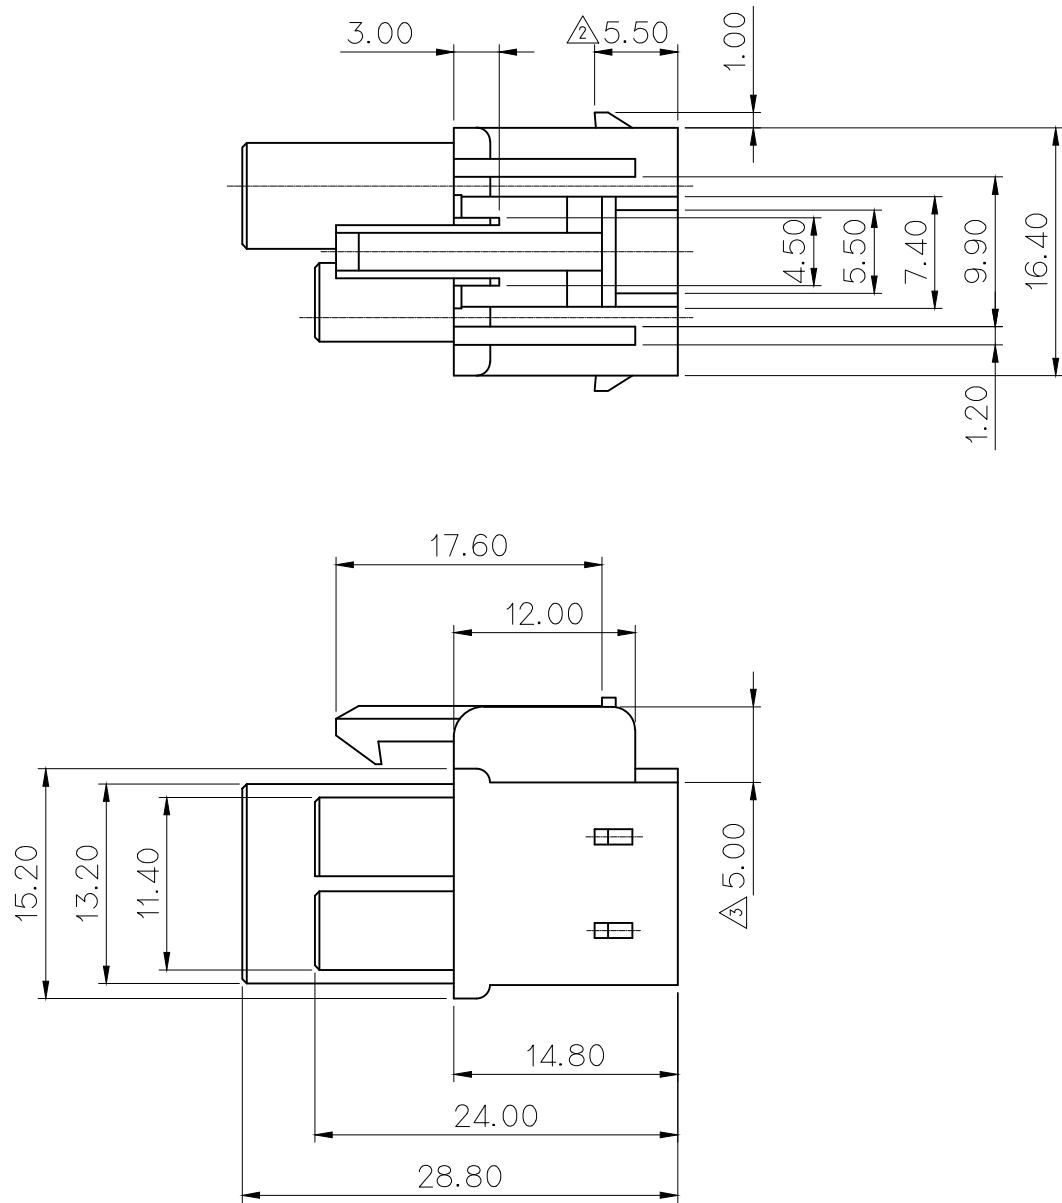


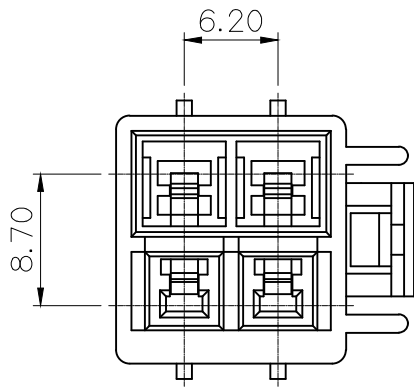

CAVITY NO.

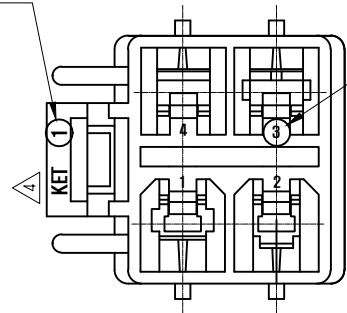


HOLE NO.

NOTE

- MUST BE FREE OF BURR, WELDLINE AND IMPERFECTION THAT AFFECT FUNCTION.
- APPLICABLE HOUSING : MG625311* / MG625312* / MG625316*
- △3 APPLICABLE TERMINAL : ST741435-**(3HOLE), ST731433-**(1HOLE)
ST741436-**(4HOLE), ST731434-**(2HOLE)
APPLICABLE REAR HOLDER : MG635317
- 6HAZARDOUS SUBSTANCES IN PARTS (Lead, Mercury,Cadmium, Hexavalent Chromium, PBBs, PBDEs) SHALL NOT EXCEED THE MAXIMUM PERMISSIBLE CONCENTRATION PRESCRIBED UNDER EU ELV DIRECTIVE & RoHS REGULATION

주 기

- 기능상 유해한 BURR 및 WELDLINE등이 없을것.
- 적용 하우징 : MG625311* / MG625312* / MG625316*
- △3 적용 터미널 : ST741435-**(3HOLE), ST731433-**(1HOLE)
ST741436-**(4HOLE), ST731434-**(2HOLE)
적용 리홀더 : MG635317
- 제품 내 함유된 6대 유해물질 (납, 수은, 카드뮴, 6가 크롬, PBBs, PBDEs)은 EU ELV 지침 및 RoHS 법규에서 지정한 최대 허용농도를 초과해서는 안 된다.

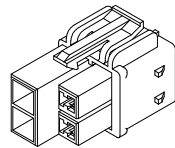

ISOMETRIC VIEW



NO.	PART NO.	MATERIAL
1	MG615310	PBT (VO)
2	MG615310T	PET/PC (G.W.I.T)

ISSUE MARK

						MATERIAL [△] SEE TABLE		 KOREA ELECTRIC TERMINAL CO., LTD.	
[△] 4	ECO-1807-137에 의한 도면 수정.	PSH	KSH	BUC	'18.07.09	FINISH NATURAL			
[△] 3	ECO-1506-543에 의한 도면 수정.	PSH	KSH	BUC	'18.01.19	WIRE RANGE		CLASS NEW 070 MULTI	
[△] 2	ECO-1111-232에 의한 도면 수정.	LCM	KSH	<i>CHK</i>	'11.11.29	INSULATION		TYPE	
[△] 1	ECO-1107-325에 의한 도면 수정.	LCM	KSH	<i>CHK</i>	'11.07.20	TOLERANCE EXCEPT AS NOTED ±0.4		SCALE 2/1	PART NO. [△] MG615310 / MG615310T
LTR	REVISION RECORD		DR.	CHK.	APP.	DATE	PART NAME		
DR. LCM '11.01.14		CHK. KSH		'11.01.14		NEW 070 MULTI 4F HOUSING			
CHK.		APP. <i>CHK</i>		'11.01.14					