

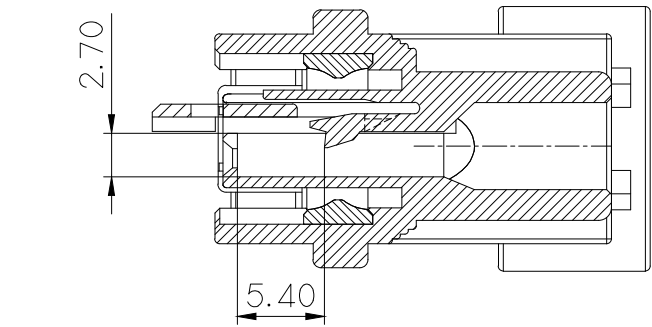
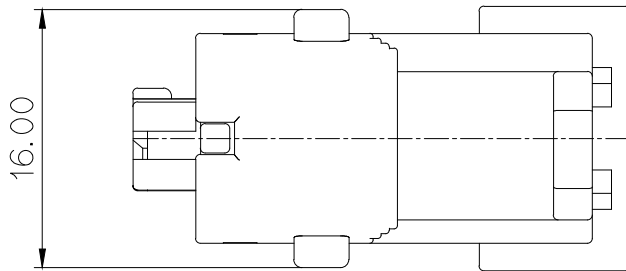
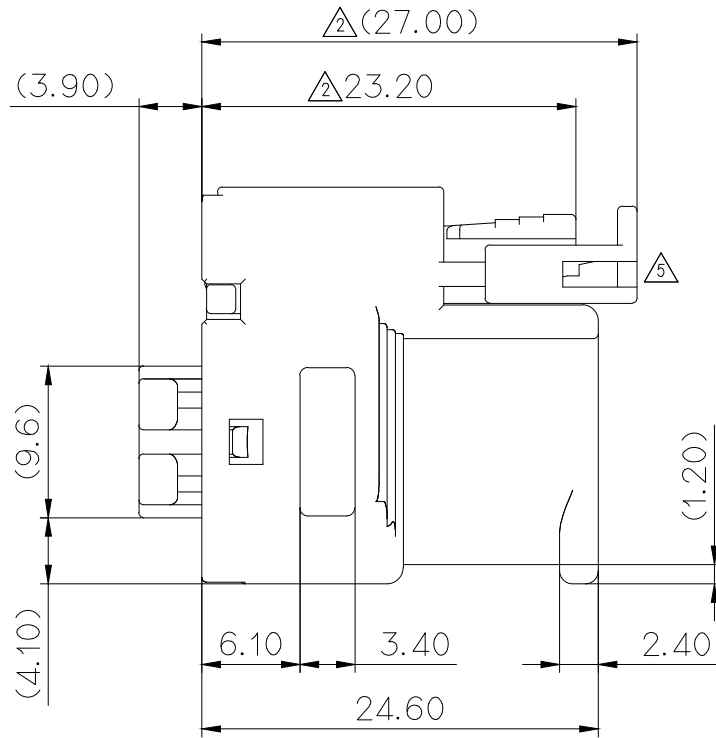


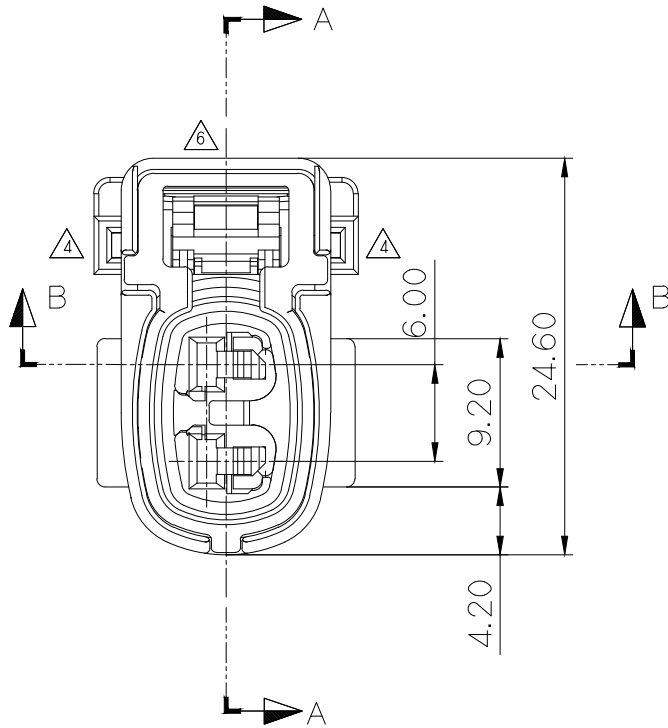

SECTION B-B


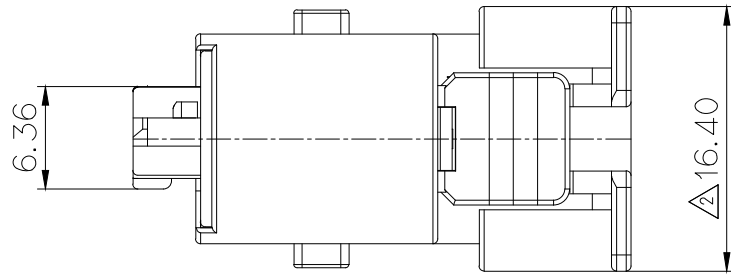


주 기

- 기능상 유해한 BURR 및 변형이 없을 것.
- 적용 TERMINAL : ST730623,624,625
- 적용 W/SEAL : MG681114, 1115, 1116, 1119
- F/HOLDER 및 TRIPLE LOCK은 1차 조립 상태임
- 제품내 함유된 6대 유해물질 (납, 수은, 카드뮴, 6가크롬, PBBs, PBDEs)은 EU ELV 지침 및 RoHS 법규에서 지정한 최대 허용 농도를 초과해서는 안된다.

GENERAL TOLERANCE (HOUSING)							USED ON
10 MAX	50 MAX	100 MAX	250 MAX	250 VR	ANGLE	ECCENT	
±0.2	±0.3	±0.55	±0.95	±1.4	±30'	0.1	

NO.	PART NO.	PART NAME	MATERIAL	FINISH
1	MG673473	090 II WP 2F HOUSING	HPA	GRAY
2	MG673475	090 II WP 2F FRONT HOLDER	HPA	NATURAL
3	MG673474	090 II WP 2F INNER SEAL STOPPER	HPA	GRAY
4	MG674105	090 II WP 2P TRIPLE LOCK	HPA	BLACK
5	R600090	090 II WP 2P INNER SEAL	SILICONE	BROWN

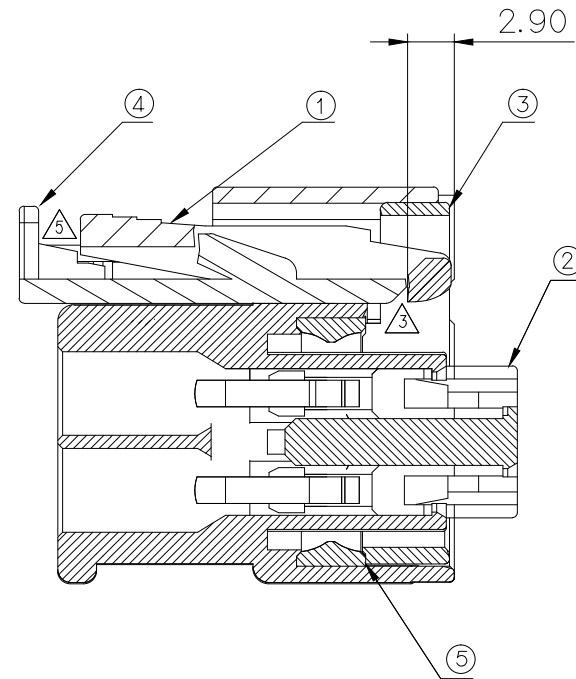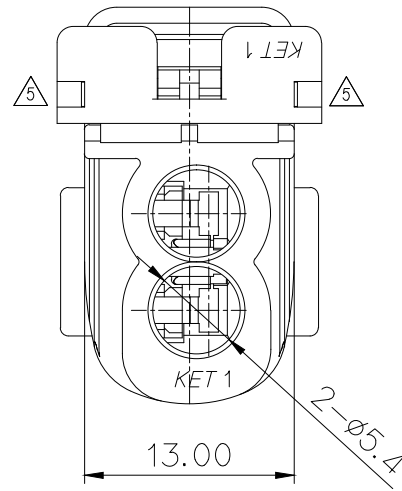

SECTION A-A

NOTE

- MUST BE FREE OF FLASH, WELDLINE AND IMPERFECTION THAT AFFECT FUNCTION.
- APPLACABLE TERMINAL : ST730623, 624, 625
- APPLACABLE W/SEAL : MG681114, 1115, 1116, 1119
- SPACER MUST BE KEEP AND SUPPLY FOR FIRST LOCKING CONDITION AS THIS DRAWING.
- 6 HAZARDOUS SUBSTANCES IN PARTS (LEAD, MERCURY, CADMIUM, HEXAVALENT CHROMIUM, PBBs, PBDEs) SHALL NOT EXCEED THE MAXIMUM PERMISSIBLE CONCENTRATION PRESCRIBED UNDER EU ELV DIRECTIVE & RoHS REGULATION.

ECO-1110-112 근거 도면 재작성 (HOUSING, TRIPLE LOCK 형상 변경)	AJH	KKJ	11.10.20	MATERIAL	SEE TABLE	 KOREA ELECTRIC TERMINAL CO., LTD.
설계사양변경(S090058)근거 도면 재작성 (TRIPLE LOCK 형상 변경)	CDH	HSH	09.03.31	FINISH	SEE TABLE	
설계사양변경(S080197)근거 도면 재작성 (TRIPLE LOCK 형상 변경)	KMH	HSH	08.08.26	WIRE RANGE		CLASS 090 II WP
설계사양변경(S070282)근거 도면 재작성	CJH	HSH	'07.12.31	INSULATION		TYPE 7283-8226
설계사양변경(S070178)근거 도면 재작성 (조립성 개선 관련 형상변경)	KBS	HSH	'07.08.16	TOLERANCE EXCEPT AS NOTED	SCALE 2/1	PART NO. MG643477
LTR REVISION RECORD	DR.	CHK.	APP.	DATE	PART NAME 090II WP 2F ASSY(HPA)	
DR. MKNO '04.07.30	CHK.					
CHK. KKJ 7/31	APP. KCH 8/2					

ECO-1508-238 근거 도면 재작성 (제결음 중대)	KCS	CKY	LSY	15.09.01
---------------------------------	-----	-----	-----	----------

APPROVED

2016-03-11

KOREA ELECTRIC
TERMINAL CO., LTD.
Korea Electric Te
rminal Co., LTD.

ISSUE MARK