
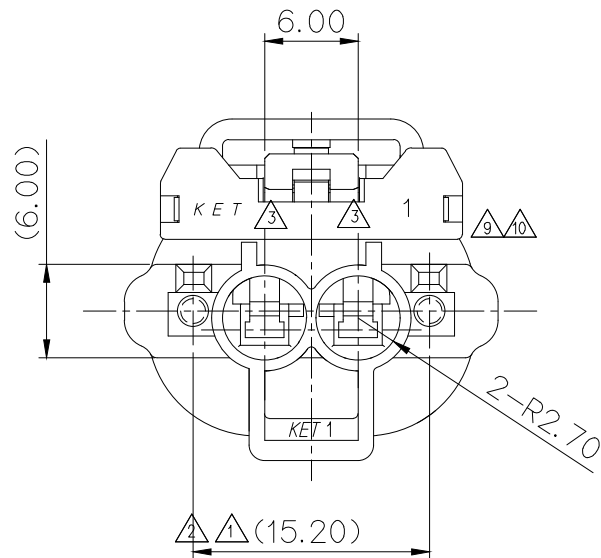
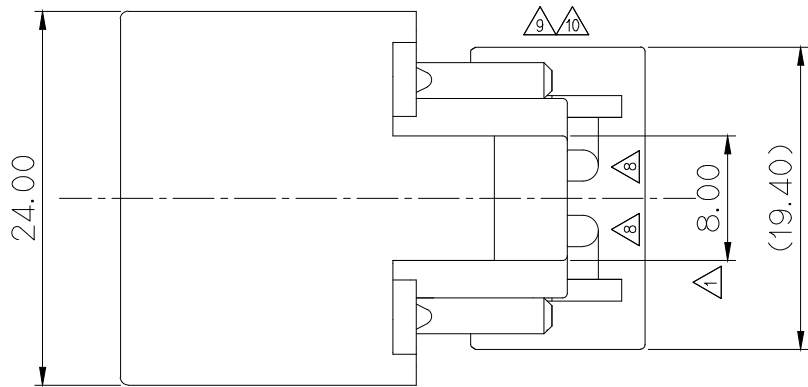
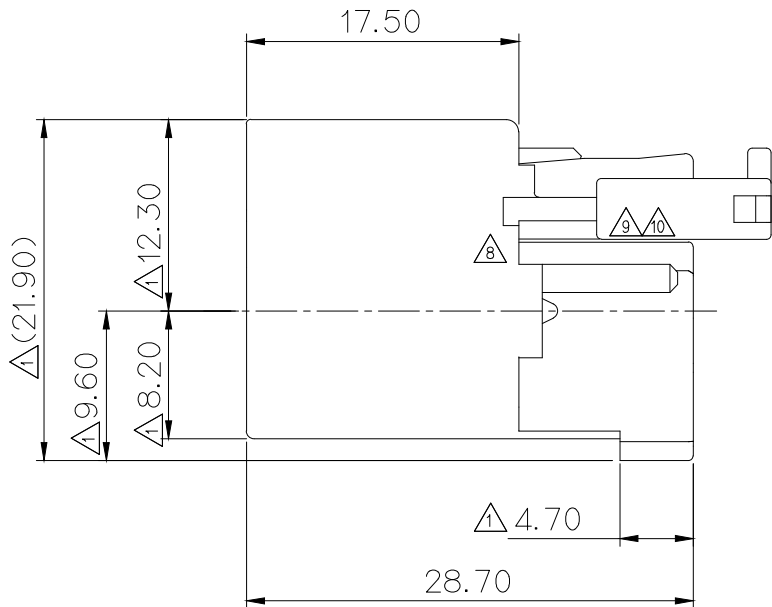


NO.	PART NAME	MATERIAL	FINISH		U/S
			BLACK (MG643753-5)	GRAY (MG643753-4)	
1	090II WP 2F HOUSING	PBT	BLACK	GRAY	1
2	090II WP 2F C.P.A	PBT	GRAY	BLACK	1
3	090II WP 2F F/HOLDER	PBT	NATURAL		1
4	INNER SEAL	SILICONE	RED		1

GENERAL TOLERANCE (SILICONE RUBBER)						GENERAL TOLERANCE (HOUSING)					USED ON
0 TO 6	6 TO 10	10 TO 18	18 TO 30	30 TO 50	50 TO 80	10MAX	20MAX	45MAX	ANGLE	ECCENT	
±0.4	±0.5	±0.6	±0.8	±1.0	±1.2	±0.2	±0.25	±0.3	±30'	0.1	

NOTE

1. 기능상 유해한 BURR 및 변형이 없을것.
2. 적용 TERMINAL: ST730623,624,625
- WIRE SEAL: MG681114,1115,1116,2841
3. F/HOLDER 및 C.P.A.는 1차 조립 상태임.
4. 시험규격은 ES91500-00에 준함.
- 5.제품내 함유된 6대 유해물질 (납,수은,카드뮴,6가크롬, PBBs,PBDEs)은 EU ELV 지침 및 RoHS 법규에서 지정한 최대 허용 농도를 초과해서는 안된다.

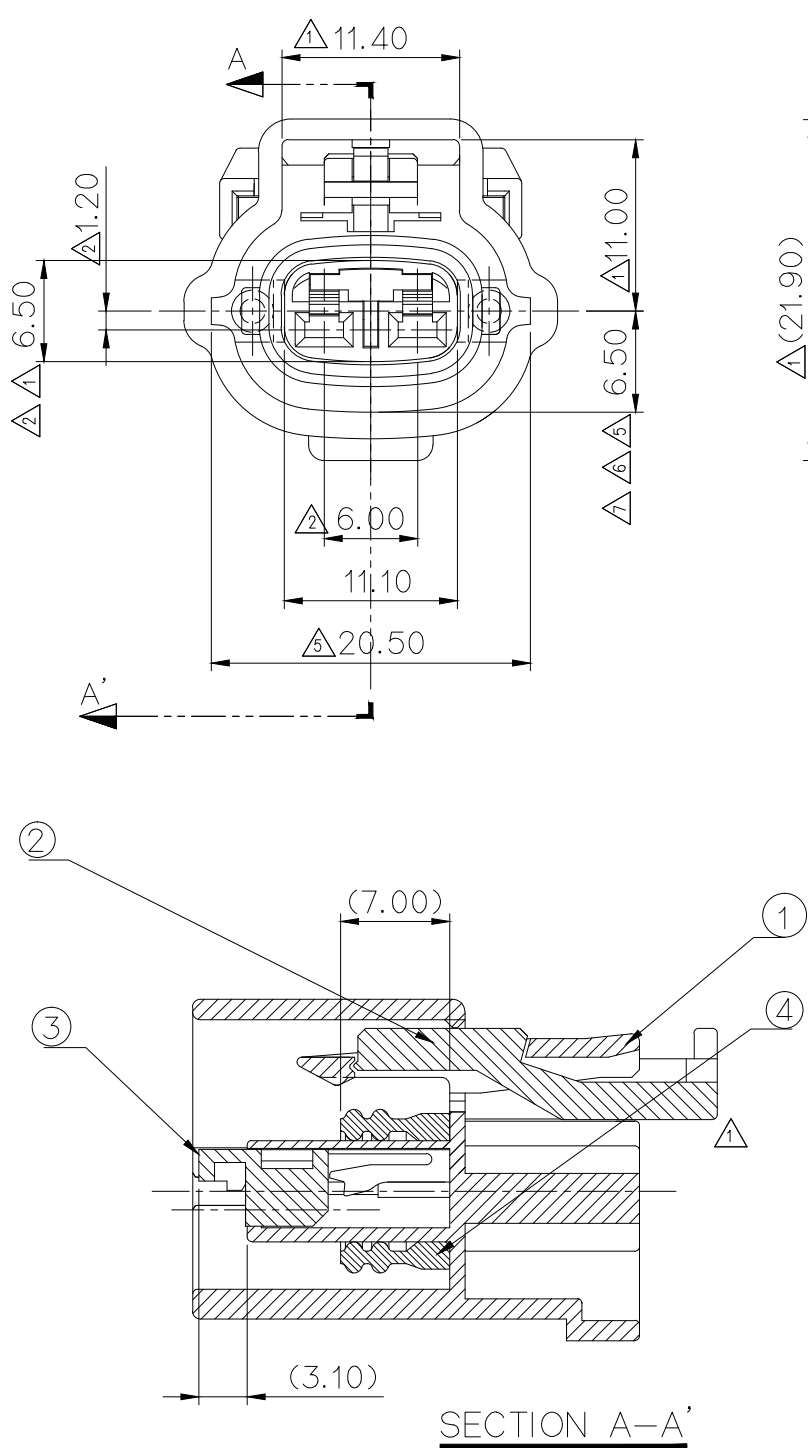

10	ECO-1601-429 근거 도면 재작성	SSY	CSH	LSY	'16.01.26
9	ECO-1312-300 근거 도면 재작성	KJH	CSH	CWK	'13.12.30
8	설계시양변경(ECO-1201-247)근거 도면 재작성 (LOCK&C.P.A Guide부 보강, C.P.A부 수정)	KBS	UYH	HSH	'12.01.12
7	설계시양변경(090032)근거 도면 재작성 (내측 실 두께 삭제)	BJG		KKJ	'09.06.16
6	설계시양변경(080301)근거 도면 재작성 (내측 실 두께 삭제)	KHS	HSH	KKJ	'08.12.01
LTR	REVISION RECORD	DR.	CHK.	APP.	DATE

5	설계시양변경(080090)근거 도면 재작성 (내측 실 두께 보강)	KHS	HSH	KKJ	'08.04.04
4	설계시양변경(080066)근거 도면 재작성 (CORNER 4곳 RIB실추가-4곳)	KBS	HSH	KKJ	'08.03.12
3	설계시양변경(080030)근거 수정 (2중 LOCK를 개선 형상변경)	YSW	HSH	KKJ	'08.02.12
2	I/SEAL 이탈 개선,오기수정,시양추가	E.S.SHIN		KKJ	'07.04.19
1	I/SEAL 색상변경, 세부 설변 반영	E.S.SHIN		KKJ	'06.09.04
LTR	REVISION RECORD	DR.	CHK.	APP.	DATE
DR.	SHIN.	'06.06.22	CHK.		
CHK.	HSW	'06.06.23	APP.		'06.06.26

MATERIAL	SEE TABLE	KIE KOREA ELECTRIC TERMINAL CO., LTD.
FINISH	SEE TABLE	
WIRE RANGE		CLASS 090II WP
INSULATION		TYPE
TOLERANCE EXCEPT AS NOTED	SEE TABLE	SCALE 2/1
PART NAME	090II WP 2F HOUSING (Tau-ENG' IGN)	

